Rapid clamp kit Mod. MX2-... and MX3...

The kit MX2-X is supplied with: 1 rapid clamp, 1 O-ring OR 3125 *, 2 exagonal nuts M5, 2 screws M5x69.

The kit MX2-Z is supplied with: 1 rapid clamp, 1 O-ring OR 3125 *, 1 exagonal nut M5, 1 screw M5x69, 1 screw M5x85 for wall fixing.


* it can be ordered separately (cod. 160-39-11/19)

The kit MX3-X is supplied with: 1 rapid clamp, 1 O-ring OR 38X2,8 **, 2 square nuts M6, 2 screws M6x75.

The kit MX3-Z is supplied with: 1 rapid clamp, 1 O-ring OR 38X2,8 **, 1 square nut M6, 1 screw M6x75, 1 screw M6x90 for wall fixing.

** it can be ordered separately (OR 38X2,8 NBR)

Materials: technopolymer clamp, NBR O-ring, zinc-plated steel nuts and screws.

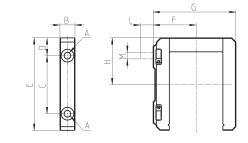

See the positioning scheme in the section "Series MX assembled FRL"

DIMENSIONS													
Mod.	А	В	С	D	E	F	G	н	L	М	Notes		
MX2-X	5.2	12	46	14	73.5	37.5	70.5	37	-	-			
MX2-Z	5.2	12	46	14	73.5	37.5	70.5	37	14	M5	kit with wall fixing screw		
МХЗ-Х	6.2	14	54	16.5	86	40	77	43.5	-	-			
MX3-Z	6.2	14	54	16.5	86	40	77	43.5	13	M6	kit with wall fixing screw		


Rapid clamp kit with wall fixing brackets - size 2




The kit MX2-Y is supplied with: 1 wall rapid clamp, 1 O-ring OR 3125 **, 2 exagonal nuts, 2 screws M5x69.

** it can be separately ordered (cod. 160-39-11/19)

Materials: technopolymer clamp, NBR O-ring, zincplated steel nuts and screws.

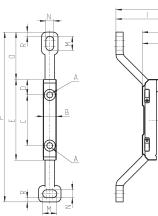

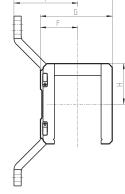

																See the posit
Mod.	А	В	С	D	Е	F	G	Н	I	L	М	Ν	0	Р	R	section "Serie
MX2-Y	5,2	12	46	14	73,5	32,5	70,5	37	70,5	103	12	6,5	42	152	4	

ee the positioning scheme in the ection "Series MX assembled FRL"